

DATE 1632Z 10 NOV 64

SECRET

TO : DIRECTOR


25X1A

FROM : [REDACTED]

ACTION:

INFO :

TOR: 1702Z 10 NOV 64

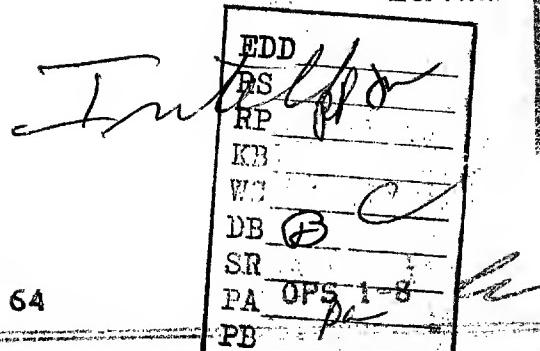

ROUTINE

IN 56970

TO 25X1A

INFO

CITE

25X1A

25X1A
25X1A

SUBJECT: FILM EVALUATION MISSION C224C.

1. CAMERA B-10 WAS USED IN MISSION C224C FLOWN ON 31 OCTOBER 1964; PROCESSING WAS ACCOMPLISHED BY [REDACTED]

25X1A



2. ORIGINAL NEGATIVE:

A. THE EXPOSURE IS ADEQUATE AND THE RESOLUTION IS GOOD.

B. 9R SIDE: FOREIGN MATTER ADHERING TO THE CENTER FIDUCIAL FORMAT EDGE CAUSED A SMALL OBSTRUCTION THROUGHOUT THE MISSION. A PROCESSOR MISTRACKING PROBLEM CAUSED MINOR WRINKLES ALONG BOTH FILM EDGES ON THE LAST 430 FRAMES. A MANUFACTURER'S SPLICE IS MADE IN FRAME 1510.

C. 9L SIDE: MANUFACTURER'S SPLICES ARE MADE IN FRAMES 538, 2074 AND 3474. THE LAST FRAME (3604) IS A PARTIAL FRAME.

D. BOTH SIDES: EDGE STATIC OCCURS INTERMITTENTLY ALONG BOTH FILM EDGES THROUGHOUT THE MISSION. PRESSURE ROLLER STATIC (CHATTER) IS PRESENT INTERMITTENTLY ALONG THE OUTBOARD EDGE OF THE FILM THROUGHOUT AND BECOMES LESS APPARENT TOWARD THE END OF

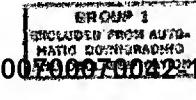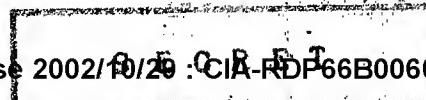

Approved For Release 2002/10/29 : CIA-RDP66B00664R000700070042-1

S E C R E T

25X1A

(IN 56970)

PAGE TWO

THE MISSION. FAINT IMAGES OF THE ADJACENT POSITION INDICATORS APPEAR EACH TIME THE CORRECT POSITION INDICATOR LAMP IS EXPOSED THROUGHOUT THE MISSION. FRAMES ARE TITLED CONSECUTIVELY FROM 000 THROUGH 3604.

E. THERE WERE NO MAJOR CAMERA MALFUNCTIONS ENCOUNTERED DURING THIS MISSION.

3. POSITIVE:

- A. PI SUITABILITY IS GOOD.
- B. PRINTING AND PROCESSING WERE GOOD.
- C. CLOUDS OBSCURE OR DEGRADE APPROXIMATELY 65 PERCENT OF THE MISSION.

END OF MESSAGE

S E C R E T